


""SITE INFORMATION

*SURVEY DATE: Janu	ary 16, 2013	*ADDRESS:	46968	308 th	Street	t, va	cated	place	
*SURVEYOR: Jim S	*COUNTY:								
		*CITY:	Beres	ford					
LOCATION DESCRIPTION: From Vermillion, South Dakota Highway 50, East 2 miles to Greenfield Road, turn left (North) 10-1/2 miles to 308th Street, turn right (East) 1 – 3/4 miles, on the left (North) side. No lane, is out in the middle of 160 acres.									
LEGAL DESCRIPTION: SE 1	⁄ ₄ , 25– 94 – 51 Gar	field Twp.							
*QUARTER 1: SE 1/4		PCK Partnership % Farmers OWNER NAME: National Bank							
*QUARTER 1:*QUARTER 2:		WNER ADDRESS:							
*TOWNSHIP: Garfield									
*RANGE: 51		OWNER CITY: Omaha OWNER STATE: Nebraska							
*SECTION: 25		OWNER STATE. <u>Nebraska</u> OWNER ZIP: 68154 - 4427							
ACRES: 162.05		QUAD NAME:							
OWNER CODE 1: P									
OWNER CODE 2:									
OWNER CODE 3:									
HISTORIC SIGNIFICANCE	:								
	1								
*DOE:	REGISTER NAME: MULTIPLE PROPERTY NAME:								
*DOE DATE:	_ MULTIPLE PR	OPERTY	NAIV	lE: _					
REASON INELIGIBLE:									
		_	C	ATEG	ORY:				
NOMINATION STATUS:	SIGNIFICANCE LEVEL 1: N S L								
DATE LISTED:		SIGNIFICANCE LEVEL 2: N S L							
REFERENCE NUMBER:	-								
HISTORIC DISTRICT RATING:			ERIA 1:	A I	3 C	D			
PERIOD:		CRITE	ERIA 2:	A I	3 C	D			
			ERIA 3:	A I	3 C	D			
		CRITE	ERIA 4:	A I	3 C	D			
SIGNIFICANCE NOTES:									



STRUCTURE DETAILS				
SHPO ID:				
*PROPERTY NAME:		-		
OTHER NAME:				
• · · · · · · · · · · · · · · · · · · ·				
			Large native rock and poured	
CURRENT FUNCTION:	Vacant	FOUNDATION:	concrete foundation	
CURRENT SUBFUNCTION:	Vacant	ROOF MATERIAL:	Cedar shingles	
HISTORIC FUNCTION:	Livestock barn	ROOF SHAPE:	Gable	
HISTORIC SUBFUNCTION:		STRUCTURAL SYSTEM:	Balloon framing	
HISTORIC SUBFUNCTION.	пау and grain storage	=		
	NI.	STYLE:	Gable roof barn	
OCCUPIED:	No	TYPE:	Livestock barn 2x6 studs, with 16"	
	Yes with		vertical siding and	
ACCESSIBLE:	permission	WALLS:	½"x6" lap siding	
STORIES:	2	SIGNIFICANT PERSON:	Anton Jensen	
*DATE OF CONSTRUCTION:		ILTURAL AFFILIATION:	?	
			•	
ALTERED/MOVED NOTES:	Original site Any evid	dence of milk cow stanchions o	r horse stalls has	
-		0' lean-to added on the West si		
		cedar lap siding applied. Origi		
		ed with poured concrete in place		
added on the West side at a la	-	ed with poured concrete in plat	669. 10 X00 16a11-10	
added on the West side at a li	ater date.			
INTERIOR NOTES: Has two	rows of 6x6 posts, a 4x6	for a beam in the South area.	6" round posts and	
4x6 beams in the North area.	Floor joists are 2x8's fo	or the hayloft floor. Has a 2x4 s	olid wall in 20' from	
the North end. The first floor	has 4x6 joists 6' O.C. wi	th 2x12's for a floor in the Sout	h 30'.	
OTHER NOTES: 2x6 stud w	alls with 2x4 girts 4' O.C	c. and original 7/8"x16" vertical	siding with 1x3	
battens. The battens were st	ripped off and ½"x6" ced	dar lap siding applied to the No	rth, East and South	
walls about the time the West	t lean-to was added. Wir	ndows are 8"x10" four light, wit	h two 8"x10" four	
light over 8"x 10" four light (horizontal brace 8' O.C.	double hung windows or	n the South wall. Rafters are 2x	6's with a 2x6	
*PHYSICAL NOTES: Barn is	s in very poor condition.			
*UTM ZONE:		*RESTRICTED: Y o	or N	
			71 I N	
*UTM EASTING: *UTM NORTHING:				
CINITACIALITING.				



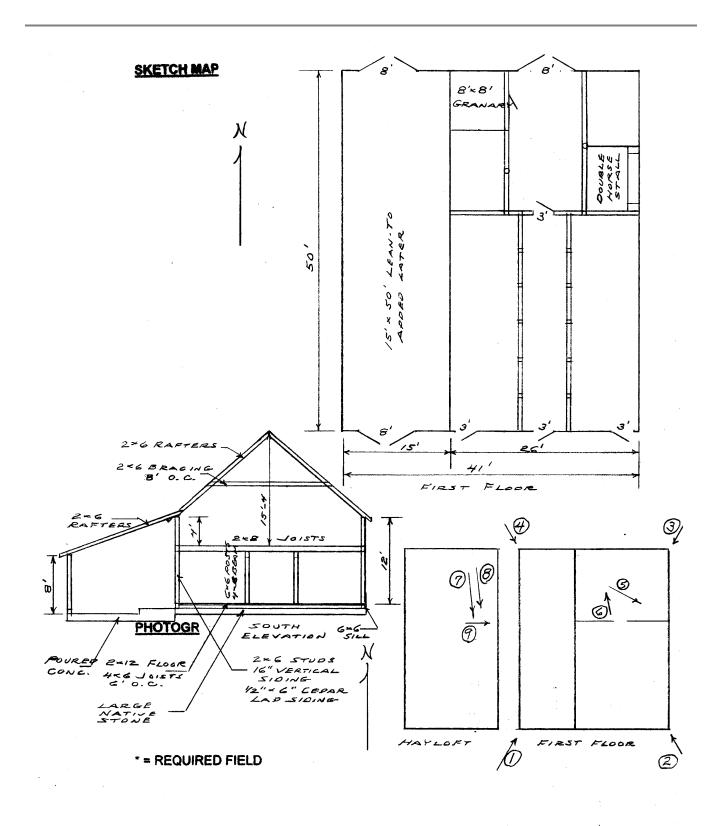





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: Looking NE, SW corner



PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: Looking NW, SE corner






PHOTOGRAPHER: __ DATE OF PHOTO:

Jim Stone January 16, 2013 ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: Looking SW, NE corner

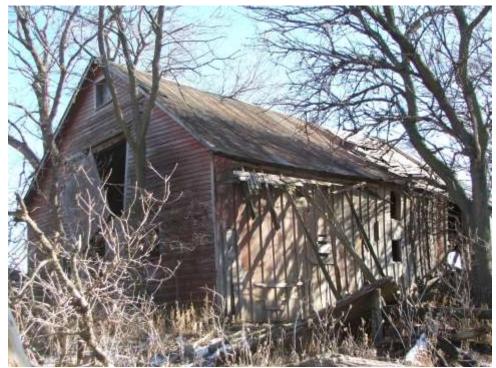

PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013 ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: Looking SE, NW corner





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, North end, looking SE, only double

CAMERA DIRECTION: horse stall still in place.



PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, looking NW, granary in the NW

CAMERA DIRECTION: corner.





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

Hayloft, looking SE, 2x6 rafters, 2x6 stud walls

CAMERA DIRECTION: with girts 4' O. C.



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: January 16, 2013

ROLL NUMBER:

PHOTO NUMBER: 8

Hayloft, looking SE, 2x6 rafters and 2x6 cross

CAMERA DIRECTION: _ bracing 8' O. C.






PHOTOGRAPHER: Jim Stone DATE OF PHOTO: January 16, 2013

ROLL NUMBER: PHOTO NUMBER:

Hayloft, looking East, 7/8"x 16" vertical rough sawn siding. I have never seen 16" wide

CAMERA DIRECTION: vertical siding.



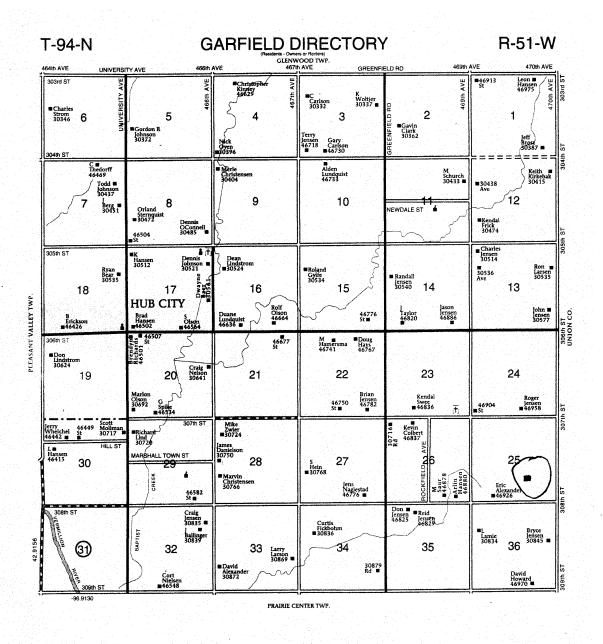

Farm & Home Publishers, Ltd. 21 CLAY CO., SD



HISTORY

Farm located in the SE ¼ of Section 25, Garfield Township, Clay County was homesteaded by Niels Hansen.

The 1901 Clay County Atlas lists H. P. Jensen as the owner.

The 1901 Clay County Atlas lists Dennis Manning as the owner.

The 1912 Clay County Atlas lists Anton Jensen as the owner.

The 1924 Clay County Atlas lists Eric Carlson as the owner.

The 1937 Clay County Atlas lists P. J. Bowman as the owner and G. Westlund as the operator.

The 1948 and 1956 Clay County Atlas lists W. L. Jenkins as the owner.