

SITE INFORMATION

*SURVEY DATE: Febru	uary 8, 2013	*ADDRESS: 46520 301th Street									
*SURVEYOR: _Jim S	*COUNTY:	Clay									
		*CITY:	Beresford								
LOCATION DESCRIPTION: From Vermillion, South Dakota Highway 50, East about 2 miles to											
Greenfield Road, Turn left (North) 17-1/2 miles to 301st Street, turn left (West) about 2-3/4 miles, on the									the		
right (North) side.											
LEGAL DESCRIPTION: S ½, S	SW ¼ & S 1/8, N ½, S	SW ¼, 20 – 95 – 51	Glenw	ood	Twp						
*QUARTER 1: SW 1/4		OWNER NAME: Steven A. Erickson									
*QUARTER 2:	OV	OWNER ADDRESS:									
*TOWNSHIP: Glenwood	 d	OWNER CITY: Beresford									
*RANGE: 51		OWNER STATE:									
*SECTION: 20		OWNER ZIP:	57004								
ACRES: 88.47		QUAD NAME:									
OWNER CODE 1: P											
OWNER CODE 2:											
OWNER CODE 3:											
HISTORIC SIGNIFICANCE											
*DOE:	REGISTER NAME:										
*DOE DATE:	MULTIPLE PROPERTY NAME:										
REASON INELIGIBLE:											
			С	ATE	GOF	RY:					
NOMINATION STATUS:	_ SIGNIFICANCE LEVEL 1: N S L							L			
DATE LISTED:		SIGNII	SIGNIFICANCE LEVEL 2: N S L				L				
REFERENCE NUMBER:											
HISTORIC DISTRICT RATING:	C or NC	CRITE	RIA 1:	Α	В	С	D				
PERIOD:			RIA 2:								
		CRITE	RIA 3:	Α	В	С	D				
		CRITE	RIA 4:	Α	В	С	D				
CIONIEIO ANOE NOTES											
SIGNIFICANCE NOTES:											

STRUCTURE DETAILS





SHPO ID:		<u></u> _								
*PROPERTY NAME:										
OTHER NAME:										
CURRENT FUNCTION:	Storage	FOUNDATION:	Native stone							
CURRENT SUBFUNCTION:	Storage	ROOF MATERIAL:	Cedar shingles							
HISTORIC FUNCTION:	Livestock barn	ROOF SHAPE:	Gable							
HISTORIC SUBFUNCTION:	Hay storage	STRUCTURAL SYSTEM:	Balloon framing							
		STYLE:	Gable roof barn							
OCCUPIED:	Yes	TYPE:	Livestock barn							
			2x4 studs, 1x6 #106							
	Yes with		drop siding & ½"x6" cedar lap							
ACCESSIBLE:	permission	WALLS:	siding							
7.00_00	p									
STORIES:	2	SIGNIFICANT PERSON:	Peter Hurtig							
*DATE OF CONSTRUCTION:	1890 to 1910	CULTURAL AFFILIATION:	?							
ALTERED/MOVED NOTES:	Original site. A	Any evidence of milk cow stanchions h	as been removed.							
14' x 42' lean-to added to the East side soon after the original barn was built. 12' x 16' lean-to was on the										
South side, but has been removed. Concrete foundation and floor are still in place.										
INTERIOR NOTES. Lies form	· · · · · · · · · · · · · · · · · · ·	Duck manta with a annual and Auctin for a	haam Daama wu							
		2x6 posts with a spacer and 4x6's for a								
North to South, 6' - 6' - 10' - 4' - 6' O. C. from the West wall and two rows of 4x6 beams running East to										
		ese beams are under the North to Sout								
OTHER NOTES: 2x6 stud walls with 1x6 #106 drop siding. Stairs, tack room, two double and one										
single horse stalls are still along the North wall. Rafters and bracing are 2x6's. Floor joists are 2x8's.										
	s rough sawn cot	tonwood. Barn has a flat roof 10' wide	e at the peak, which							
Is very unusual for a barn.										
*PHYSICAL NOTES: Barn is	s in very poor co	ndition. Flat roof at the peak is rotted	out and gone.							
*UTM ZONE:		*RESTRICTED: Y o	or N							
*UTM EASTING:										
*UTM NORTHING:										
	<u> </u>									

* = REQUIRED FIELD




SKETCH MAP

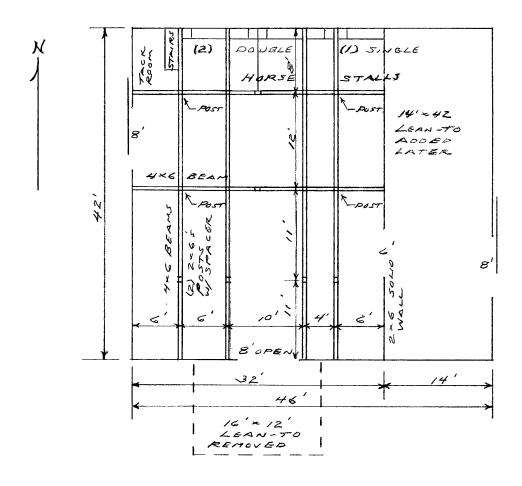

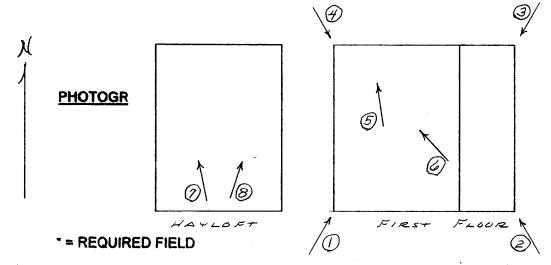



SKETCH MAP

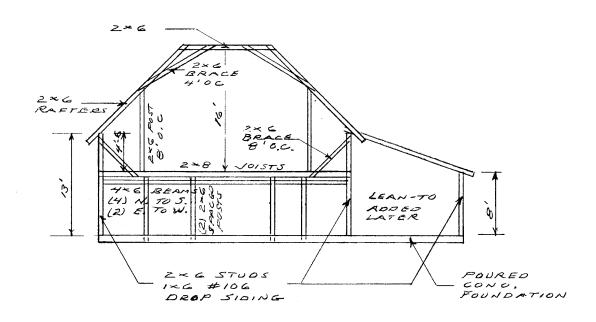

SOUTH ELEVATION

PHOTOGR

* = REQUIRED FIELD





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone February 8, 2013

ROLL NUMBER: PHOTO NUMBER:

Looking NE, SW corner,

CAMERA DIRECTION: note flat roof at the peak



PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone **February 8, 2013** **ROLL NUMBER:**

PHOTO NUMBER:

CAMERA DIRECTION: Looking NW, SE corner





PHOTOGRAPHER: DATE OF PHOTO: Jim Stone

February 8, 2013

ROLL NUMBER:

PHOTO NUMBER:

CAMERA DIRECTION: Looking SW, NE corner



PHOTOGRAPHER: DATE OF PHOTO: Jim Stone

February 8, 2013

ROLL NUMBER:

PHOTO NUMBER:

CAMERA DIRECTION: Looking SE, NW corner






PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone February 8, 2013 ROLL NUMBER: PHOTO NUMBER:

5

First floor, looking NW, 4x6 beams under 4x6 beams, tack room, stairs

CAMERA DIRECTION: and double horse stall

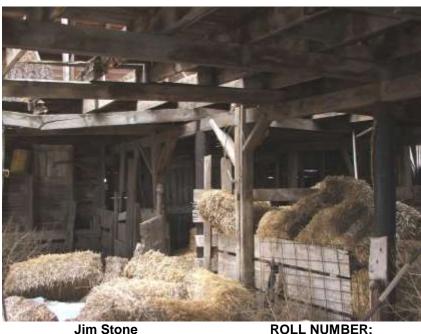

PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone February 8, 2013

PHOTO NUMBER:

6

First floor, looking NW, 4x6 beam under 4x6

CAMERA DIRECTION: beams, 2x8 floor joists





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone February 8, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, looking up into hayloft, Floor rotted out, 2x6 rafters and 2x6

CAMERA DIRECTION: bracing





PHOTOGRAPHER:


Jim Stone DATE OF PHOTO: February 8, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, looking up into hayloft, floor rotted out, 2x6 rafters and 2x6

CAMERA DIRECTION: bracing



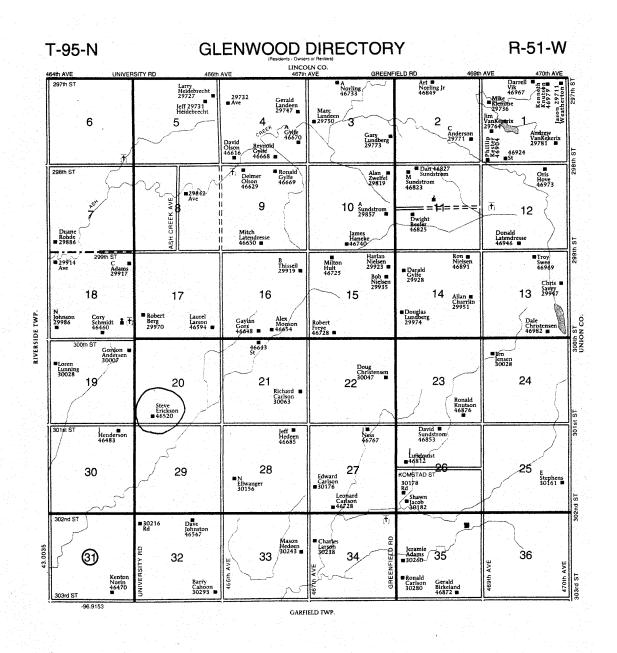

© Farm & Home Publishers, Ltd.

23

CLAY CO., SD



HISTORY

This farm located in the SW ¼ of Section 20, Glenwood Township, Clay County was homesteaded by John P. Lundin.

The 1894 and 1901 Clay County Atlas lists Peter Hurtig as the owner. The farm was called "Northland".

The 1912, 1924 and 1937 Clay County Atlas lists Ellen Hurtig as the owner. P. S. Peterson is listed as the operator.

1948 Clay County Atlas lists Sig Erickson as the owner.

The 1956 Clay County atlas lists Lydia Beckstrom as the owner.