

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**SITE INFORMATION**

\*SURVEY DATE: August 29, 2013 \*ADDRESS: 31245 466<sup>th</sup> Ave.  
\*SURVEYOR: Jim Stone \*COUNTY: Clay  
\*CITY: Vermillion

LOCATION DESCRIPTION: From Vermillion, South Dakota Highway 50 East about 2miles, turn left (North) 5 miles to 312th Street, turn left (West) one mile to 466<sup>th</sup> Ave., turn left (South) about 1/4 mile, on the right (West) side.

LEGAL DESCRIPTION: Parcel A, NE 1/4, 20 - 93 - 51, EXC Lot 1, Prairie Center Twp.

\*QUARTER 1: NE 1/4  
\*QUARTER 2: \_\_\_\_\_  
\*TOWNSHIP: Prairie Center  
\*RANGE: 51  
\*SECTION: 20  
ACRES: 206.49

OWNER NAME: Jeffery & Jacqueline Olson  
OWNER ADDRESS: 31245 466<sup>th</sup> Ave.  
OWNER CITY: Vermillion  
OWNER STATE: So. Dak.  
OWNER ZIP: 57069  
QUAD NAME: \_\_\_\_\_

OWNER CODE 1: P  
OWNER CODE 2: \_\_\_\_\_  
OWNER CODE 3: \_\_\_\_\_

**HISTORIC SIGNIFICANCE**

\*DOE: \_\_\_\_\_  
\*DOE DATE: \_\_\_\_\_  
REASON INELIGIBLE: \_\_\_\_\_

REGISTER NAME: \_\_\_\_\_  
MULTIPLE PROPERTY NAME: \_\_\_\_\_

NOMINATION STATUS: \_\_\_\_\_  
DATE LISTED: \_\_\_\_\_  
REFERENCE NUMBER: \_\_\_\_\_  
HISTORIC DISTRICT RATING: C or NC  
PERIOD: \_\_\_\_\_

CATEGORY: \_\_\_\_\_  
SIGNIFICANCE LEVEL 1: N S L  
SIGNIFICANCE LEVEL 2: N S L  
CRITERIA 1: A B C D  
CRITERIA 2: A B C D  
CRITERIA 3: A B C D  
CRITERIA 4: A B C D

SIGNIFICANCE NOTES: \_\_\_\_\_

**STRUCTURE DETAILS**

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



SHPO ID: \_\_\_\_\_

\*PROPERTY NAME: \_\_\_\_\_

OTHER NAME: \_\_\_\_\_

CURRENT FUNCTION: Sheep barn FOUNDATION: Poured concrete  
Steel roofing over

CURRENT SUBFUNCTION: Lambing barn ROOF MATERIAL: cedar shingles

HISTORIC FUNCTION: Livestock barn ROOF SHAPE: Gable roof

HISTORIC SUBFUNCTION: Hay & grain storage STRUCTURAL SYSTEM: Balloon framing

OCCUPIED: Yes STYLE: Western feeder barn

ACCESSIBLE: Yes with permission TYPE: Livestock barn  
2x4 studs, 1x10  
shiplap, steel  
roofing

WALLS: \_\_\_\_\_

STORIES: 2 SIGNIFICANT PERSON: Simon Ernstson

\*DATE OF CONSTRUCTION: Late 1800's CULTURAL AFFILIATION: ?

**ALTERED/MOVED NOTES:** Original site. Roof covered with steel roofing over cedar shingles. All evidence of milk cow stanchions and horse stalls has been removed. North wall of center barn has the bottom 8' of the open 2x4 wall removed with steel pipe posts and channel iron supporting wall and hayloft above. 2x6 bracing added in the South lean-to to support the center of rafters. Exterior walls covered with steel roofing applied horizontally. Posts under 4x6 beam in the center of the barn have been replaced with steel pipe posts. 2x6 bracing added in South lean-to to support center of rafters 2' O. C.

**INTERIOR NOTES:** One row of steel pipe posts with 4x6's for beam support 2x6 joists for hayloft floor. 11' x 8' gravity feed granary still in the NE corner of hayloft. 2x6 floor joists are doubled in this area. 2x6 rafters with 2x6 bracing horizontal bracing added later, 8' up and 2' O. C.

**OTHER NOTES:** 2x4 stud walls with 1x10 shiplap and steel roofing on all four walls. Wood cupola, that dates this barn before 1900. Windows were 9"x 12" four light. 2x4 studs, 2x6 floor joists, 2x6 rafters, 4x6 beams and roof sheathing are all rough sawn cottonwood.

\*PHYSICAL NOTES: Barn is in fair condition. \*RESTRICTED: Y or N


\*UTM EASTING: \_\_\_\_\_

\*UTM NORTHING: \_\_\_\_\_

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**SKETCH MAP**

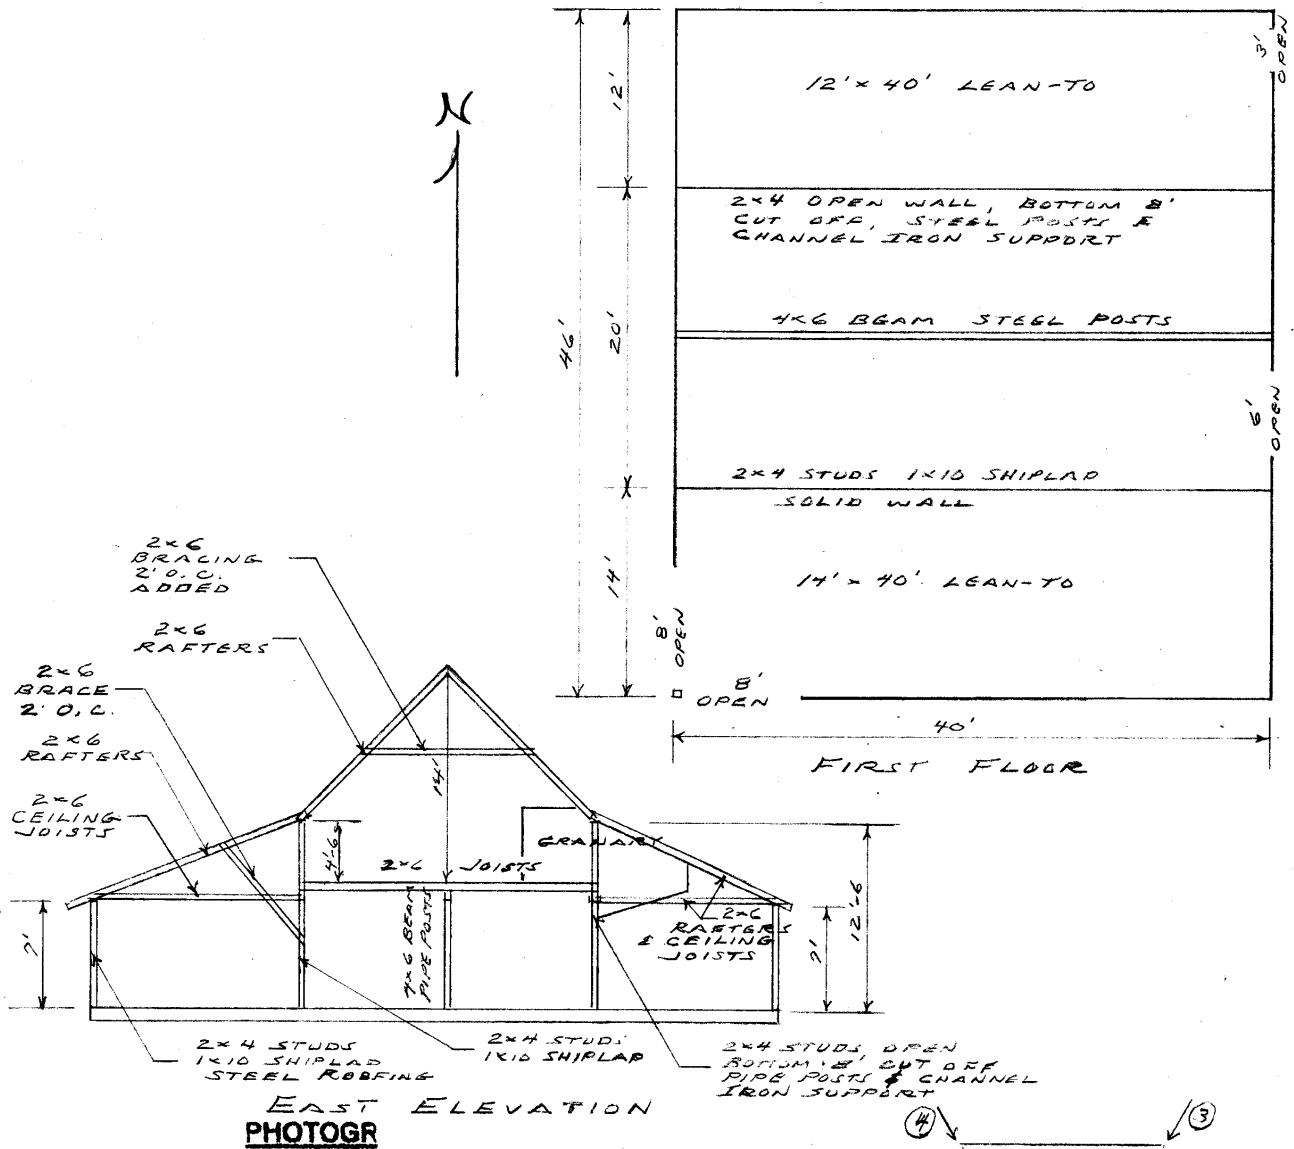

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 1  
**CAMERA DIRECTION:** Looking NE, SW corner



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 2  
**CAMERA DIRECTION:** Looking NW, SE corner

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 3  
**CAMERA DIRECTION:** Looking SW, NE corner



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 4  
**CAMERA DIRECTION:** Looking SE, NW corner

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 5

**CAMERA DIRECTION:** South lean-to, looking NE, 2x6 rafters, 2x6 ceiling joists. 2x6 bracing added to support the center of rafters.



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 6

**CAMERA DIRECTION:** First floor, looking SW, steel pipe posts, 4x6 beam, 2x6 floor joists.

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 7

**First floor, looking NW,  
bottom 8' of open 2x4  
wall removed, steel pipe  
posts and channel iron  
support wall and North  
side of hayloft.**

**CAMERA DIRECTION:** \_\_\_\_\_



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 8

**Hayloft, looking NW, 2x6  
rafters and 2x6 bracing  
for rafters, open 2x4 wall.**

**CAMERA DIRECTION:** \_\_\_\_\_

\* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**PHOTOGRAPHER:** Jim Stone  
**DATE OF PHOTO:** August 29, 2013

**ROLL NUMBER:** \_\_\_\_\_  
**PHOTO NUMBER:** 9


**CAMERA DIRECTION:** Hayloft, looking NE, 2x6  
rafters and 11' x 8'  
gravity feed granary in  
the NE corner of hayloft,



**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE  
HISTORIC SITES SURVEY STRUCTURE FORM**



**T-93-N PRAIRIE CENTER DIRECTORY R-51-W**

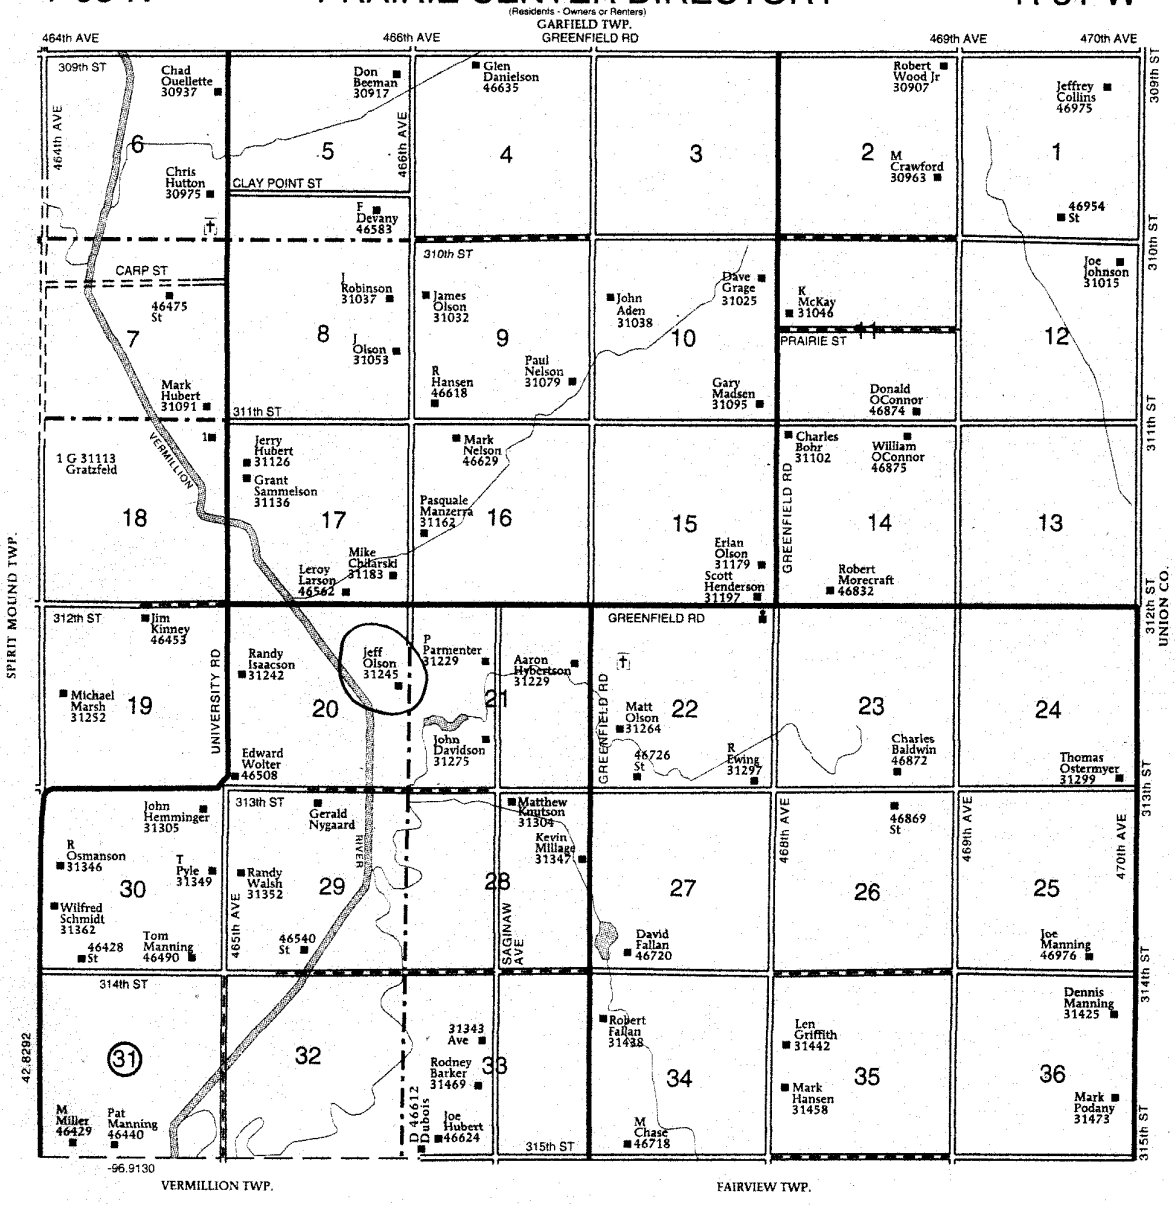

\* = REQUIRED FIELD

## **History**

This farm located in the NE ¼ of Section 20, Prairie Center Township, Clay County was homesteaded by Harrison Washburne.

The 1894 and 1901 Clay County Atlas lists Simon Ernstson as the owner

The 1912 Clay County Atlas lists Rasmus Nelson as the owner.

The 1924 Clay County Atlas lists Christ Nelson as the owner.

The 1937 Clay County Atlas lists A. J. Struble as the owner.

The 1948 and 1956 Clay County Atlas lists T. Oden as the owner. (Thorvald Oden) owner of International Harvester dealership, Oden Implement in Vermillion.