


""SITE INFORMATION													
*SURVEY DATE: June 5, 2013		2013	*ADDRESS:		30020 458 th Ave.								
*SURVEY	OR: Jim Stor	ie	*COUNTY:	Clay									
			*CITY:	TY: Centerville									
LOCATION DESCRIPTION: From Vermillion, the intersection of South Dakota Highway 50 bi-pass and													
South Dakota Highway 19, North15 miles to 302 nd Street, turn left, (West) about 4 miles to 458 th Ave., turn													
right (North) 1/3/4 miles, on the right (East) side.													
LEGAL DESCRIPTION: Lots 1 & 2, NW ¼, 19–95 – 52 Riverside Twp.													
*QUARTER 1:	NW 1/4	c	WNER NAME:	David I	L. & ⁻	Timo	thy	o. c	stre	m			
*QUARTER 2:		OWN	OWNER ADDRESS: 29765 458th Ave										
*TOWNSHIP:	Riverside		OWNER CITY:	Centerville									
*RANGE:	52	0	OWNER STATE: South Dakota										
*SECTION:	19		OWNER ZIP: 57014										
ACRES:	150.53		QUAD NAME:										
OWNER CODE 1:	Р												
OWNER CODE 2:													
OWNER CODE 3:													
HISTORIC SIGNIFICANCE													
*DOE:			REGISTER NAME:										
*DOE DATE:			MULTIPLE PROPERTY NAME:										
REASON INELIGIBLE:													
				C	ATE	GOR'	Y:						
NOMINATION STATUS:			SIGNIFICANCE LEVEL 1: N S L										
DATE LISTED:			SIGNIFICANCE LEVEL 2: N S L										
REFERENCE	NUMBER:												
HISTORIC DISTRIC	T RATING: C or	NC	CRITE	RIA 1:	Α	В	С	D					
	PERIOD:		CRITE	RIA 2:	Α	В	С	D					
			CRITE	RIA 3:	Α	В	С	D					
			CRITE	RIA 4:	Α	В	С	D					
SIGNIFICANCE NOTES:													


STRUCTURE DETAILS



SHPO ID:											
*PROPERTY NAME:											
OTHER NAME:											
CURRENT FUNCTION:	Cow calf barn	FOUNDATION:	Poured concrete								
			Steel over cedar								
CURRENT SUBFUNCTION:	Storage	ROOF MATERIAL:	shingles								
HISTORIC FUNCTION:	Livestock barn	ROOF SHAPE:	-								
HISTORIC SUBFUNCTION:	Hay storage	STRUCTURAL SYSTEM:	Balloon framing								
		STYLE:	Western feeder barn								
OCCUPIED:	Yes	TYPE:	Livestock barn								
ACCECCIDI E.	Yes with	WALL C.	2x4 and 2x6 studs,								
ACCESSIBLE:	permission	WALLS:	1x6 #106 drop siding								
STORIES:	2	SIGNIFICANT PERSON:									
*DATE OF CONSTRUCTION:		CULTURAL AFFILIATION:	?								
DATE OF CONSTRUCTION.	Larry 1900 S	COLTONAL ATTILIATION.	i								
ALTERED/MOVED NOTES:	Original site Mo	ost evidence of horse stalls and or mil	k cow stanchions has								
-		d over cedar shingles on the roof. Tw									
		verhead door installed in the South w									
		en poured later under the main barn a									
A concrete want o o mgm ap	pears to have bee	on poured later under the main barn a	na the Last lean to.								
INTERIOR NOTES: Two row	s of 6"x6" posts,	and 6x8 beams support the 2x6 joists	for the hayloft floor								
		d East sides. The lean-to's have one									
4x4 beam to support the rafters. Most evidence of horse stalls or milk cow stanchions has been removed, but were in the East lean-to. Two double horse stalls on the North end with milk cow stanchions at the											
		vall down to floor 8' – 10' – 10' – 8' O.									
		6 #106 drop siding on all four walls. T									
		Shiplap. Rafters are 2x6's on the ma									
Steel roofing over cedar shin		ompiapi Nationa are 2xa a an ine ma	in barrana loan to or								
Steel rooming over cedar simil	igies.										
*PHYSICAL NOTES: Barn is	s in fair condition										
0.0/12 110 120. Daili 1	z idii Gondidioni										
*LITM 70NC		*DECTRICTED: V -	M								
		*RESTRICTED: Y o	r N								
*UTM EASTING:											
*UTM NORTHING:											




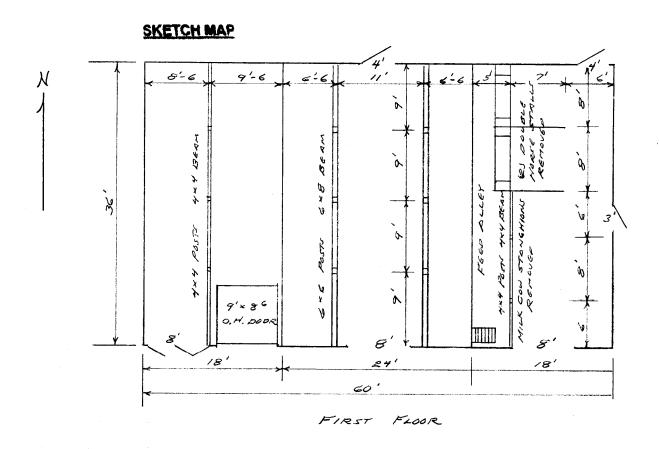

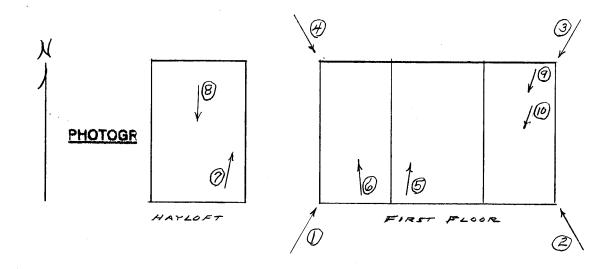



SKETCH MAP

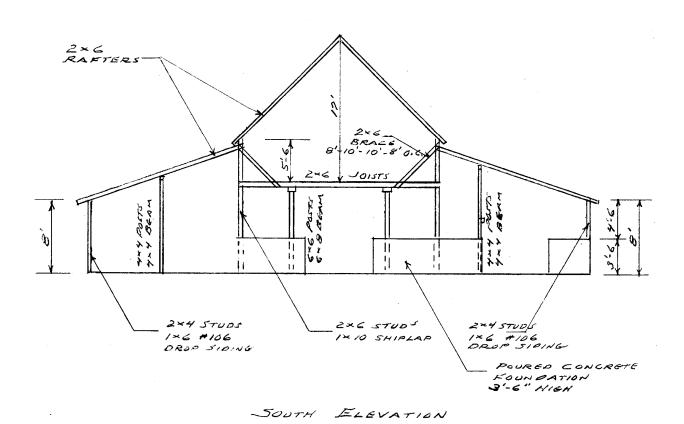

PHOTOGR





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone June 5, 2013

ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: Looking NE, SW corner



PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone June 5, 2013 **ROLL NUMBER:**

PHOTO NUMBER:

CAMERA DIRECTION: Looking NW, SE corner





PHOTOGRAPHER: Jim Stone ROLL NUMBER: DATE OF PHOTO: June 5, 2013 PHOTO NUMBER: 3
CAMERA DIRECTION: Looking SW, NE corner



PHOTOGRAPHER: Jim Stone ROLL NUMBER: DATE OF PHOTO: June 5, 2013 PHOTO NUMBER: 4
CAMERA DIRECTION: Looking SE, NW corner





PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone June 5, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, center of barn, looking NE, 6x6 post, 6x8 beam, 2x6

CAMERA DIRECTION: joists.



PHOTOGRAPHER: DATE OF PHOTO:


Jim Stone June 5, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, West lean-to, looking NW, 4x4 posts, 4x4 beam supporting

CAMERA DIRECTION: rafters.



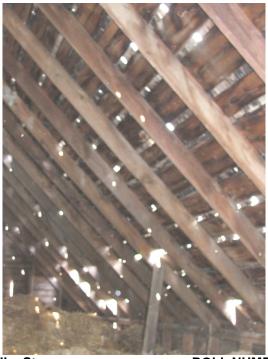


PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone June 5, 2013

ROLL NUMBER: PHOTO NUMBER:

Hayloft, looking NE, 2x6

CAMERA DIRECTION: _rafters.

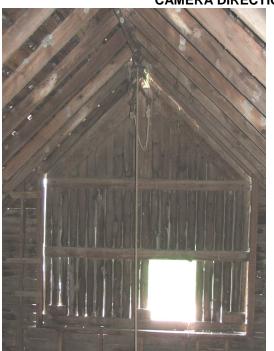

PHOTOGRAPHER: Jim Stone

DATE OF PHOTO: June 5, 2013

ROLL NUMBER:

PHOTO NUMBER:

Hayloft, looking South, 2x6 rafters and hayloft

CAMERA DIRECTION: door on the South wall.





PHOTOGRAPHER: Jim Stone DATE OF PHOTO: June 5, 2013

ROLL NUMBER: PHOTO NUMBER:

First floor, East lean-to, looking SW, evidence of

CAMERA DIRECTION: horse stalls.



PHOTOGRAPHER: Jim Stone DATE OF PHOTO:

June 5, 2013


ROLL NUMBER: PHOTO NUMBER:

10

First floor, East lean-to, looking SW, evidence of milk cow stanchions at the South end & stairs to

CAMERA DIRECTION: hayloft.



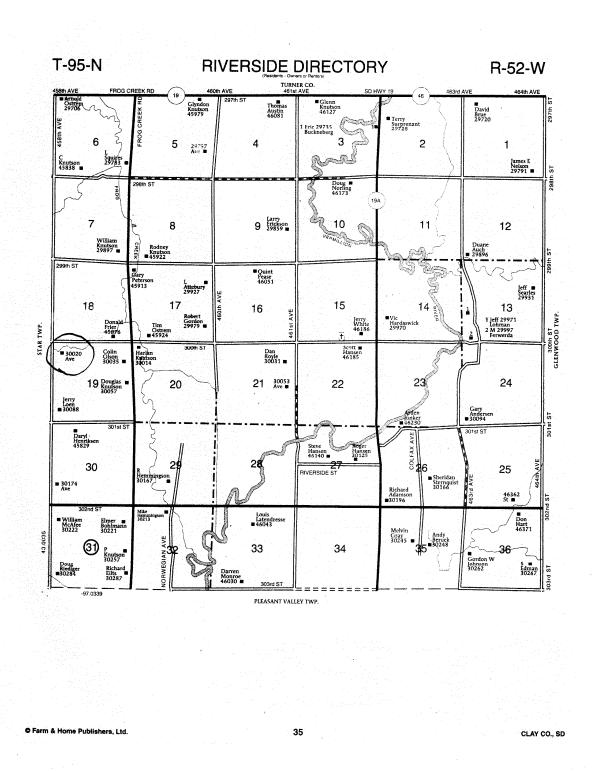



HISTORY

This farm located in the NW ¼ of Section 19, Riverside Township, Clay County was homesteaded by Fredrick Kreebs.

The 1894 Clay County Atlas lists Sara Blatchford as the owner.

The 1901 Clay County Atlas lists Maurice Steadman as the owner.

The 1912, 1924, 1937, 1948 and 1956 Clay County Atlas lists William Hall as the owner.

