

```SITE INFORMATION

*SURVEY DATE: _____ *SURVEYOR:

November 18, 2013 Jim Stone *ADDRESS: 30975 University Road

*COUNTY: <u>Clay</u>

*CITY: Vermillion

LOCATION DESCRIPTION: From Vermillion, from Intersection of South Dakota Highway 50 bi-pass and University Road (North) about 9-1/4 miles to Clay Point Street, turn left (West) is actually a lane, about ¹/₂ mile back into the farmstead.

side.

LEGAL DESCRIPTION: Parcel C in S 1/2, S 1/2, 6 – 93 – 51 Prairie Center Twp.

*QUARTER 1:	S 1/2	OWNER NAME: Mary C. Hutton
*QUARTER 2:		OWNER ADDRESS: 30975 University Road
*TOWNSHIP:	Prairie Center	OWNER CITY: Vermillion
*RANGE:	51	OWNER STATE: So. Dak.
*SECTION:	6	OWNER ZIP: <u>57069</u>
ACRES:	7.97	QUAD NAME:
OWNER CODE 1:	Р	
OWNER CODE 2:		
OWNER CODE 3:		
HISTORIC SIGN	IFICANCE	
*D(OE:	REGISTER NAME:
	TE:	
REASON INELIGIB	LE:	
		CATEGORY:
NOMINATIO	N STATUS:	SIGNIFICANCE LEVEL 1: N S L
DAT	TE LISTED:	SIGNIFICANCE LEVEL 2: N S L
REFERENCE	NUMBER:	
HISTORIC DISTRIC	TRATING: C or	NC CRITERIA 1: A B C D
	PERIOD:	CRITERIA 2: A B C D
		CRITERIA 3: A B C D
		CRITERIA 4: A B C D
SIGNIFICANCE NO	TES:	
STRUCTURE DE	TAILS	



SHPO ID:				
*PROPERTY NAME:				
OTHER NAME:				
CURRENT FUNCTION:	Vacant	FOUNDAT	ION:	Poured concrete
				Steel over cedar
CURRENT SUBFUNCTION:	Storage	ROOF MATER	IAL:	shingles
HISTORIC FUNCTION:	Livestock barn	ROOF SH	APE:	Gambrel roof
HISTORIC SUBFUNCTION:	Hay storage	STRUCTURAL SYST	EM:	Balloon framing
		ST	YLE:	Gambrel roof barn
OCCUPIED:	No	יד	YPE:	Livestock barn
				8" x 8' concrete
				block walls. 2x6
	N 141			studs, 1x8 shiplap
	Yes with			and ½"x6" cedar lap
ACCESSIBLE:	permission	WALLS:		siding on gable ends
STORIES:	2	SIGNIFICANT PERSON:		J. E. Johnson
*DATE OF CONSTRUCTION:	1915 or 1925	CULTURAL AFFILIATION:		?

ALTERED/MOVED NOTES: Original site. 1-1/4" x 26" galvanized, corrugated steel roofing applied over cedar shingles on roof. Steel cables added on the East and West walls at the bottom and the top to stop the walls from spreading. Some of the horse stalls or pens have been removed from the North side.

INTERIOR NOTES: <u>One of the double horse stalls and all of the milk cow stanchions are still in place.</u> Two rows of 6x6 posts and (3) 2x8's for beams support the hayloft floor. Floor joists are 2x8's

Two rows of (2) 2x6's spaced for posts support (3) 2x6's for a plate/ beam at the roof hip.


OTHER NOTES: 8" x 8' concrete block walls on all four walls. 2x6 stud walls with 1x8 ship and ½" x 6"

cedar lap siding above th	e block walls on the gable ends. Windows are 10"x 12" six light (3 wide and 2
high). Rafters are 2x6's.	Metal cupola still on the roof, but top cone is very low, it hardly shows from the

ground, looks unusual.

*PHYSICAL NOTES:	Barn is in good condition. Except the North and South walls are spreading, about 1-1/2" now.	*RESTRICTED:	Y or N	J
*UTM EASTING:				
*UTM NORTHING:				



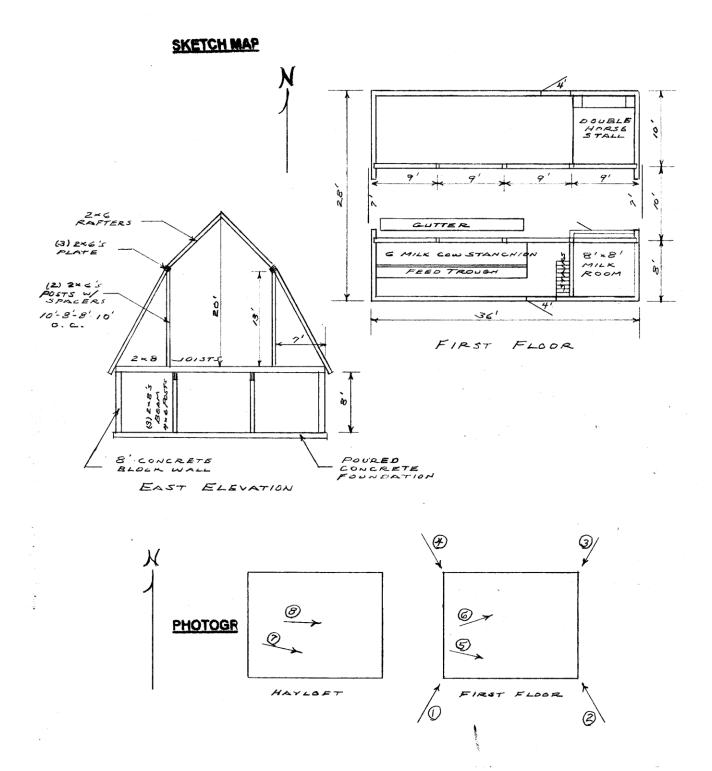





* = REQUIRED FIELD









PHOTOGRAPHER: Jim Stone DATE OF PHOTO: November 18, 2013

ROLL NUMBER: PHOTO NUMBER:

CAMERA DIRECTION: the South side

5 First floor, looking SE, milk cow stanchions on the South side



PHOTOGRAPHER: Jim Stone DATE OF PHOTO: November 18, 2013

ROLL NUMBER: PHOTO NUMBER:

PHOTO NUMBER: 6 First floor, looking NE, 6x6 posts, (3) 2x8's for a beam, 2x8 floor joists, one double horse stall in the NE corner still in CAMERA DIRECTION: place.

* = REQUIRED FIELD






PHOTOGRAPHER: DATE OF PHOTO:

Jim Stone November 18, 2013

ROLL NUMBER: PHOTO NUMBER:

Hayloft, looking SE, 2x6 rafters, triple 2x6 beam at the hip, (2) 2x6's spaced for posts that CAMERA DIRECTION: support the roof hip.

7

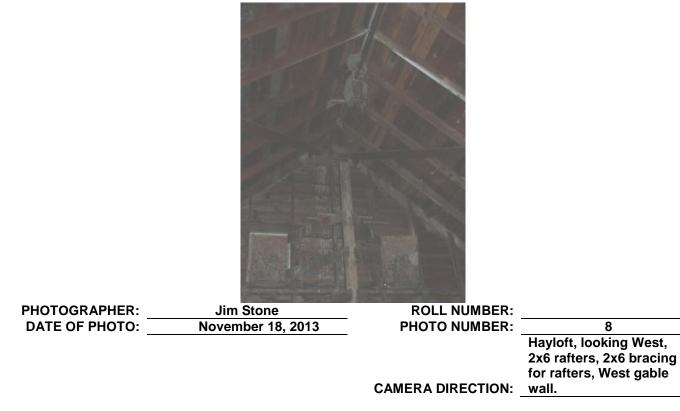



T-93-N	PRAIRIE				R-51-W
309th ST Chad Ouellette 30937	Don B Beeman 30917	Glen Danielson 46635		Robert II Wood Ir 30907	Jeffrey Collins 46975
SAV 446-6	5 tigg	4	3	2 M Crawford 30963 •	1
CARP ST ====================================	F Detwany 46583 100m S 1007 ■ 31037 ■ 31037 ■ 3103 3103 ■ 3103 3103 ■		Bive Bire Bire Bire Bire Bire Bire Bire Bir	K McKay 31046 PRAIRIE ST	-5t
Mark Hubert 31091	0 1 Glion - 31053 - R Hanse 46611 311th ST	Paul	Gary Madsen 31095	Donald OConnor 46874 ■	
1 G 31113 Gratufeld	Hubert = 31126 = Grant Sammelson 31136 Pasqual	Mark Nelson 46629		Charles Bohr William 31102 OConnor G 46875 G	
18	17 Mike Chartel Laroy 51183	* 16	15 Erian Olson 31179 Scott Henderson 31177	u u g B B Robert Morecraft ■ 46832	13
312m ST IIm Kinney 46453	Randy left Parmer Istacson 31242 31229	Aaron Hybertson 31229	GREENFIELD RD		
Michael March 31252 19	20 Edward Wolter 46508	lson	A Matt J Olson 1264 11 € 5t 1297 1297 1297 1297 1297 1297	23 Charles Baldwin 40872	24 Thomas Ostermyer 31299
John Hemminger 31305 R Osmanson 31346 Pyle	313th ST Gerald Nygaard Randy	Matthew Knutson 31304 Kevin Millage 31347		6869 A 46869 A 46869	469th AVE 470th AVE 470th AVE 470th AVE
30 ³¹³⁴⁹ Wilfred Schmidt 31362 Tom 46428 Manning 5t 46490	₩aids ₩ 31352 ₹ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$ \$	ave Ave	27	26	25 Manning 46976 ■
314th ST	32	343	Robert Fallan 31438	Len Griffith 31442	Dennis Manning 31425
Miller Patmaning	S2 Rodine Banke Sate Sate Sate Sate Sate Sate Sate Sat	•	34 Chase #46718	• Mark Hansen 31458	36 Mark P Podany 31473

VERMILLION TWP.

FAIRVIEW TWP.

© Farm & Home Publishers, Ltd.

33

CLAY CO., SD



History

This farm located in the S $\frac{1}{2}$ of the S $\frac{1}{2}$ of Section 6, Prairie Center Township, Clay County was homesteaded by Jonas Rulberg.

The 1894 Clay County Atlas lists Margaret Johnson as the owner.

The 1901 and 1912 Clay County Atlas lists J. E. Johnson as the owner.

The 1924 and 1937 Clay County Atlas lists Elizabeth M. Johnson as the owner.

The 1948 and 1956 Clay County Atlas lists E. L. Austin as the owner.