

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



SITE INFORMATION

*SURVEY DATE: July 17, 2012 *ADDRESS: 31442 452nd Ave.
*SURVEYOR: Jim Stone *COUNTY: Clay
*CITY: Gayville

LOCATION DESCRIPTION: From intersection of South Dakota Highway 50 bi-pass and South Dakota Highway 19, West on South Dakota Highway 50 about 8-1/4 miles to 454th Ave, turn left (South) 1 mile to 313th Street, turn right (West) 2 miles to 452nd Ave., turn left (South) about 1-1/3 miles, on left (East) side.

LEGAL DESCRIPTION: N 370' of S 790', S 1/2 lot 2, NW 1/4, 31 - 93 - 53 Meckling Twp.

*QUARTER 1: NW 1/4
*QUARTER 2: _____
*TOWNSHIP: Meckling
*RANGE: 53
*SECTION: 31
ACRES: 2.64

OWNER NAME: Jason A. Miller
OWNER ADDRESS: 31442 452nd Ave.
OWNER CITY: Gayville
OWNER STATE: South Dakota
OWNER ZIP: 57031
QUAD NAME: _____

OWNER CODE 1: P
OWNER CODE 2: F S L P
OWNER CODE 3: F S L P

HISTORIC SIGNIFICANCE

*DOE: _____
*DOE DATE: _____
REASON INELIGIBLE: _____

REGISTER NAME: _____
MULTIPLE PROPERTY NAME: _____

NOMINATION STATUS: _____
DATE LISTED: _____
REFERENCE NUMBER: _____
HISTORIC DISTRICT RATING: C or NC
PERIOD: _____

CATEGORY: _____
SIGNIFICANCE LEVEL 1: N S L
SIGNIFICANCE LEVEL 2: N S L

CRITERIA 1: A B C D
CRITERIA 2: A B C D
CRITERIA 3: A B C D
CRITERIA 4: A B C D

SIGNIFICANCE NOTES: _____

STRUCTURE DETAILS

* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



SHPO ID: _____
 *PROPERTY NAME: _____
 OTHER NAME: _____

CURRENT FUNCTION: Shop and farm machinery storage FOUNDATION: Poured concrete
 CURRENT SUBFUNCTION: Storage ROOF MATERIAL: Steel over cedar shingles
 HISTORIC FUNCTION: Livestock barn ROOF SHAPE: Gambrel
 HISTORIC SUBFUNCTION: Hay storage STRUCTURAL SYSTEM: Balloon framing
 OCCUPIED: Yes STYLE: Gambrel roof barn
 TYPE: Livestock barn
 ACCESSIBLE: Yes with permission WALLS: 2x6, 1x8 shiplap sheathing, 1x6 #106 drop siding

STORIES: 2 SIGNIFICANT PERSON: Calvin Hanson
 *DATE OF CONSTRUCTION: ? CULTURAL AFFILIATION: ?

ALTERED/MOVED NOTES: Original site. Steel roofing has been installed on the roof. All of the horse stalls and stanchions and granary have been removed. A 17'-6" x 34' lean-to has been added on The East side much later.

INTERIOR NOTES: Has two rows (three ply 2x6-2x4-2x6) posts and three 2x8's beams to support the hayloft floor. Floor joists are 2x8's. Has a staircase to the hayloft. There was a 8'x12' granary in the NW corner. Some horse stalls may have faced the center with an alley on the North wall, but I am not sure.

OTHER NOTES: Windows are double hung, 8"x10" four light over 8"x10" four light for ventilation. Walls are 2x6 with 1x8 shiplap sheathing and 1x6 #106 drop siding. All four walls are 12' high, with 2x6 studs above to the roof line on the gable ends.


*PHYSICAL NOTES: Barn is in good condition. Needs some repair on doors and windows.

* = REQUIRED FIELD


**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



SKETCH MAP

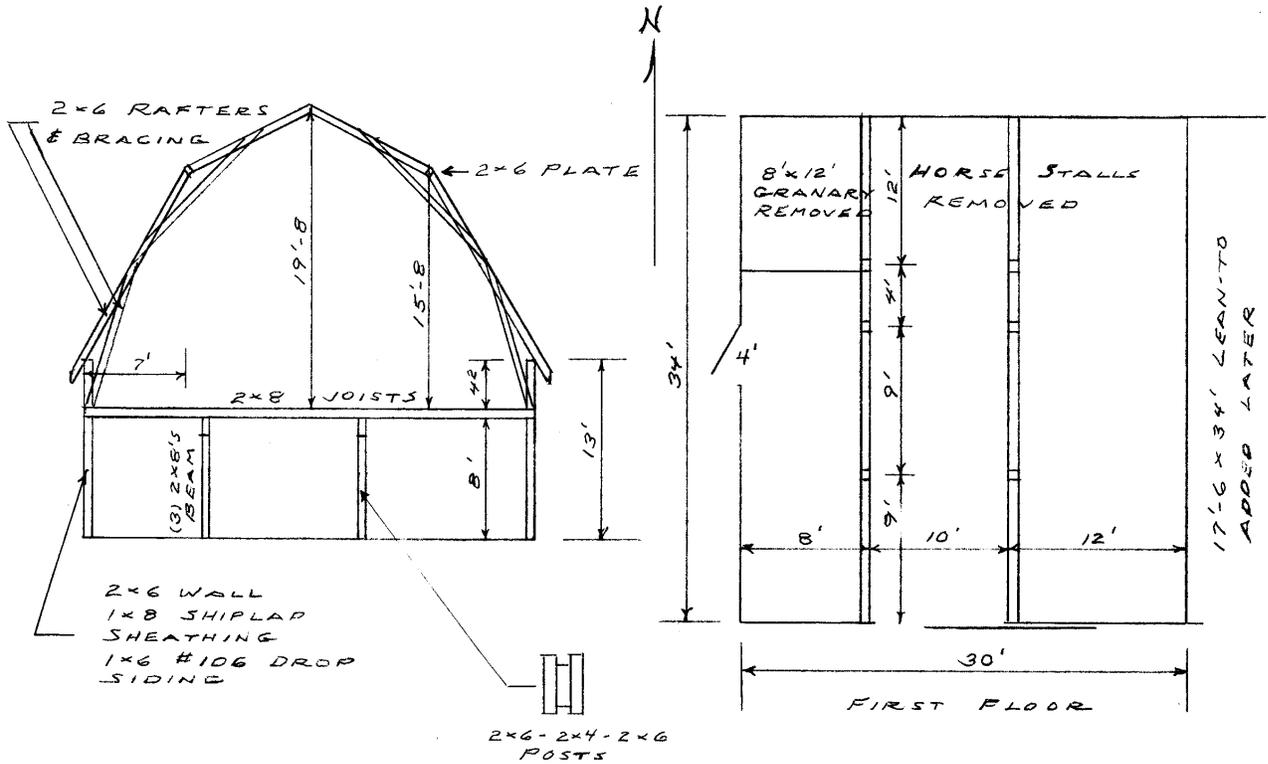

PHOTOGRAPHS

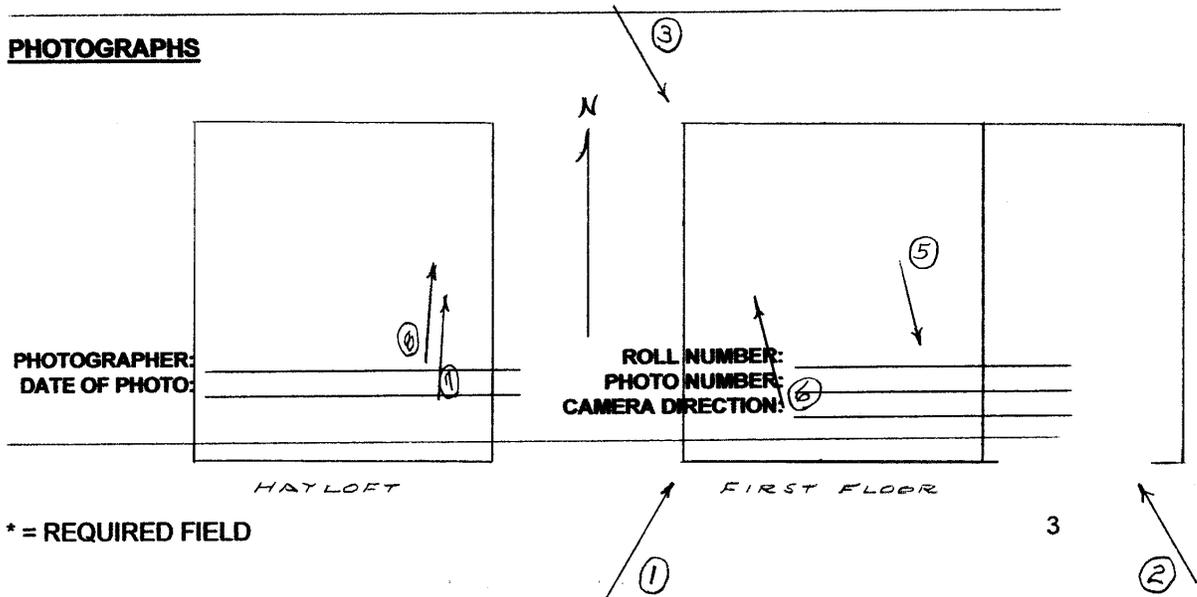

PHOTOGRAPHER: _____
DATE OF PHOTO: _____

ROLL NUMBER: _____
PHOTO NUMBER: _____
CAMERA DIRECTION: _____

* = REQUIRED FIELD

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 1
CAMERA DIRECTION: Looking NE, SW corner



**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 2
CAMERA DIRECTION: Looking NW, SE corner



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 3
CAMERA DIRECTION: Looking SE, NW corner

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 4

**First floor, looking North,
posts and beam, note
3ply 2x6 – 2x4 – 2x6**

CAMERA DIRECTION: posts



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 5

**First floor, looking
South, Stairs to hayloft**

CAMERA DIRECTION: Stairs to hayloft

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 6

CAMERA DIRECTION: Hayloft, looking North,
wall and lower rafter
bracing



PHOTOGRAPHER: Jim Stone
DATE OF PHOTO: July 17, 2012

ROLL NUMBER: _____
PHOTO NUMBER: 7

CAMERA DIRECTION: Hayloft, looking North,
upper rafter bracing

**SOUTH DAKOTA STATE HISTORIC PRESERVATION OFFICE
HISTORIC SITES SURVEY STRUCTURE FORM**



HISTORY

This farm, located in the S ½ of the NW ¼, Section 31, Meckling Township, Clay County was homesteaded by Grove Buel.

The 1894 Clay County Atlas lists E. H. Sande as the owner.

The 1901 Clay County Atlas lists Peter Lund as the owner.

The 1912 Clay County Atlas lists Nels Lund as the owner.

The 1924 and 1937 Clay County Atlas lists S. N. Anderson as the owner.

The 1948 Clay County Atlas lists Soren Miller as the owner.

The 1956 Clay County Atlas lists Hans Miller as the owner.